


Sta-Strap Interference with Throttle Cable Sleeve – 1992 75 thru 115

MARINER AND MERCURY

S/N 0D096367 thru 0D107109

Inspect the sta-strap that holds the fuel line to the carburetor air intake. If the sta-strap locking tab is pointing straight out, it may contact the throttle cable sleeve at full throttle. This contact may prevent full throttle operation.

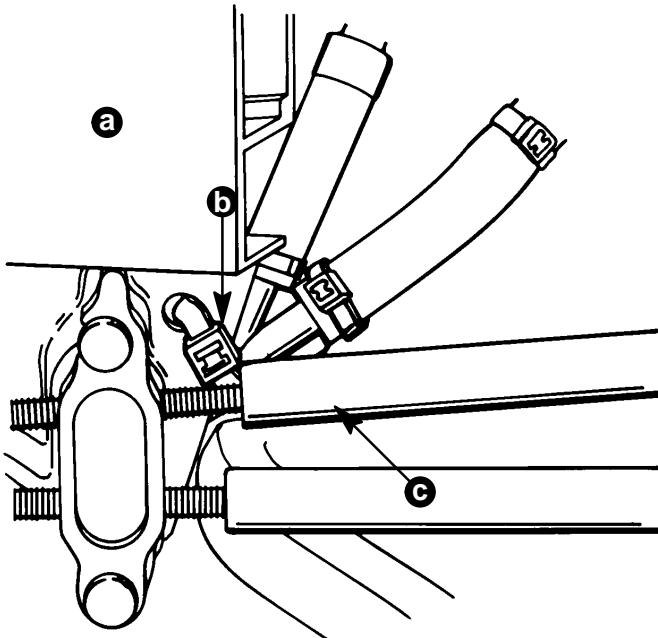


51544

- a - Carburetor Air Intake
- b - Sta-Strap
- c - Throttle Cable Sleeve

Sta-Strap Locking Tab Contacting Throttle Cable Sleeve

CORRECTION:

Turn the sta-strap until the locking tab is down and can not contact the throttle cable sleeve.

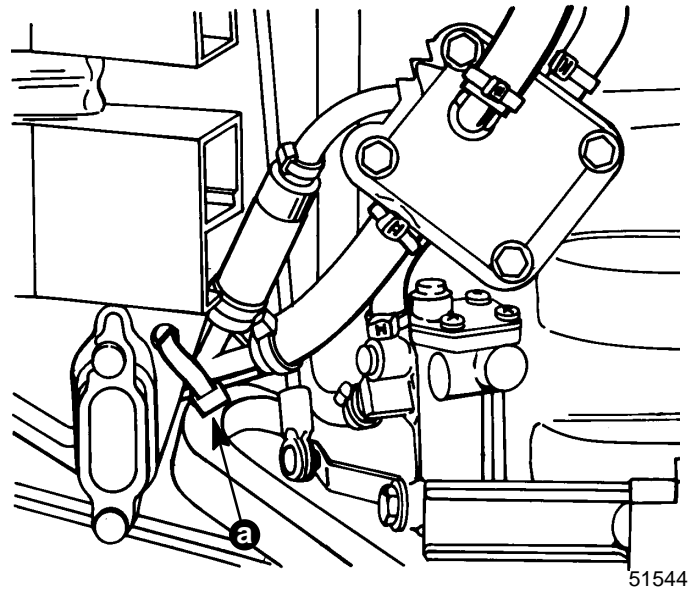

51544

a - Sta-Strap

Sta-Strap Locking Tab in Correct Position

WARRANTY:

Complete warranty claim listing:

Outboard serial number

Two tenths (0.2) hour labor

Warranty labor rate code NJC

Failure code 713 82