


## Spark Plug Change - 225

### Mariner and Mercury

#### 1994 225 Models


S/N 0D280813 thru 0G001038

Outboards within the serial numbers listed have NGK BP8H-N-10 spark plugs installed. It is possible to have radio frequency interference (RFI) from the spark plugs that could cause the warning horn to sound intermittently even when the systems are operating correctly. Neither the "TEMP" nor the "OIL" warning light comes on. To correct the sounding of a false warning horn install NGK BPZ8H-N-10 inductor spark plugs. These inductor spark plugs are installed in 225 models beginning with serial number 0G001039.

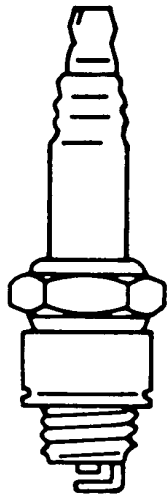


51173

NGK BP8H-N-10 Spark Plug

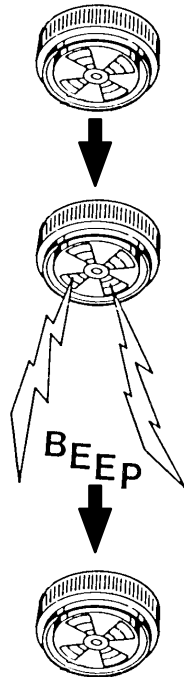


51613

Possible Intermittent False Horn

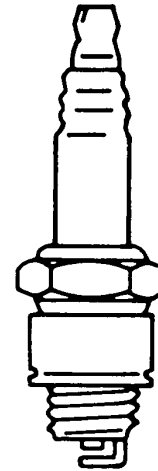

NGK BPZ8H-N-10 Spark Plug

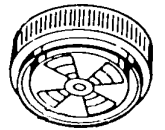

NO False Horn

### CORRECTION:

Install BPZ8H-N-10 spark plugs in 225 models s/n 0D280813 thru 0G001038:

- before delivery to the customer or
- if a complaint is received of a false warning horn.

### PARTS REQUIRED:

Qty. 6 p/n 33-816837--2 NGK BPZ8H-N-10 Spark Plug.

### WARRANTY:

Complete warranty claim listing:

Qty. 6 p/n 33-816837--2 NGK BPZ8H-N-10 Spark Plug.

One (1) hour labor.

Warranty Labor Rate Code NJC

Failure Code 320 40

US & Canada - Tag and hold parts for 60 days after credit is received.

International - Hold parts for inspection/disposal by a Marine Power International technical representative.