



# service bulletin

No. 94-5

## Water Pump Base Replacement - 30/40

## **Mariner and Mercury**

1994<sup>1</sup>/<sub>2</sub> 30/40 Serial Number US 0G053314 thru 0G071765

Outboards listed, may have had the lower seal in the water pump base damaged during manufacturing. Damage to this seal could, after prolonged operating time allow water to enter the gear housing causing damage.

#### OWNER NOTIFICATION:

As there were only a small number of registered units at the time this problem was detected, a customer letter will not be issued.

Please contact the owners of any affected outboards that your dealership may have delivered and arrange to have the water pump base replaced.


#### **CORRECTION:**

IMPORTANT: Remove any burrs on the drive shaft using 320 grit carborundum cloth prior to removing the water pump impeller.

- Remove the gear housing assembly and disassemble the water pump components to gain access to the water pump base. Refer to 30/40 Service Manual 90-826148.
- 2. With the gear housing secured in the upright position, remove the vent plug.

IMPORTANT: Protect the gasket surfaces of the water pump area of the gear housing with a shop towel when removing the water pump base.

3. Use a locking pliers to pull, or two screw drivers to pry the water pump base out of the gear housing (Figure 1).

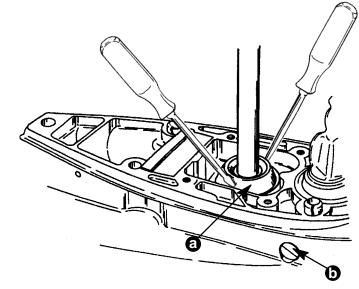


- a Water Pump Base
- b Vent Plug

## Figure 1. Water Pump Base Removal

NOTE: If you are not able to remove the water pump base as described, remove the water pump base along with the drive shaft as outlined in the service manual.

4. Apply a light coating of 2-4-C Marine Lubricant with Teflon (92-825407A12) onto a new o-ring and install the o-ring into the groove around the replacement water pump base (Figure 2).

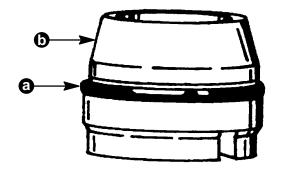

52825


- a O-Ring
- b Water Pump Base

Figure 2. O-Ring Installation.

5. Push the new water pump base into gear housing (Figure 3).

IMPORTANT: When installing water pump cover, make sure drive shaft is centered in opening of pump cover and pump cover screws are torqued in sequence shown. The drive shaft should be free to be turned by hand and not rub on the water pump cover.

 Assemble the water pump components (with new gaskets), install the vent plug, and install gear housing as outlined in 30/40 Service Manual 90-826148.

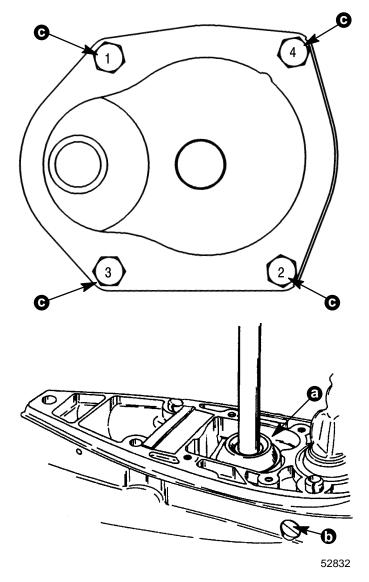

- a Water Pump Base
- b Vent Plug
- c Bolts [Torque 60 lb. in. (6.8 N·m)]


## Figure 3. Water Pump Base Installation

7. Mark a repaired outboard with a white paint dot on the upper rear corner of the exhaust cover (Figure 4).

#### **REWORK/PART IDENTIFICATION:**

Outboards with in the serial number range listed that have been reworked at the factory are identified by:

- A blue dot sticker applied on the outboard serial number label of the shipping carton.
- A white dot painted on the upper rear corner of the exhaust cover (Figure 4).

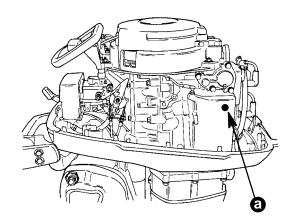

a - White Paint Dot

Figure 4. Rework Identification

94-5 494 **- 2 -**

#### DEALER SERVICE STOCK:

Replace the water pump base for any of the following service assemblies/accessory kits in your stock that have a date code prior to "03 MAR 94".

## Part Number Description

Water Pump Base Gear Housing (Short-
Black) Gear Housing (Long- Black)
Gear Housing (LL-Long Black)
Gear Housing (Short- Gray)
Gear Housing (Long- Gray)
Gear Housing (LL-Long Gray)
Gear Housing (Basic- Black)
Gear Housing (Basic- Gray)
Drive Shaft Extension Kit (Black)
Drive Shaft Extension Kit (Gray)

#### **DEALER OUTBOARD INVENTORY:**

Affected outboards in dealer inventory MUST BE reworked prior to customer delivery.

#### WARRANTY:

#### **Outboards:**

- Complete a warranty claim listing:
- Outboard serial number.

•	Qty. 1 p/n 46-821307A2	Water Pump
		Base

Gasket - Water Qty. 1 p/n 27-822189 Pump Cover

Qty. 1 p/n 27-822217 Gasket - Water Pump Face Plate

1.3 hours labor

Labor Rate Code: NJC

Failure Code: 613 00

#### **Dealer Service Stock:**

Complete a warranty claim listing:

The part number of the service assembly/accessory kit that you are replacing the water pump base on. Multiple part numbers can be listed on a single claim.

•	Qty. 1 p/n 46-821307A2	Water Pump Base
•	Qty. 1 p/n 27-822189	Gasket - Water Pump Cover
•	Qty. 1 p/n 27-822217	Gasket - Water Pump Face Plate
•	0.3 hours labor	

0.3 nours labo

Labor Rate Code: NJC

Failure Code: 613 00

### Outboards/Dealer Service Stock:

US and Canada: Return water pump base assemblies with warranty claim.

International: Hold water pump base for inspection/ disposal by a Marine Power International technical representative.