



No. 2000-16

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager


Official Notification Federal Boat Safety Act Shift Link 3.0 Litre

Models Affected

MERCURY/MARINER

1999/2000 Model Year 225/250 HP, EFI 200/225 HP, Optimax 3.0 Litre Carb/Work versions S/N 0G927950 thru 0T264046

Some shift links may have insufficient weld penetration between the bracket and shift cable attaching stud. This could result in possible attaching stud breakage and loss of shift control.

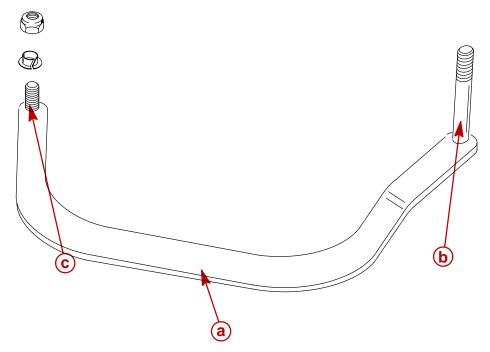

- a Shift Link Bracket
- **b** Control Cable Attaching Stud
- c Shift Link to Upper Shift Shaft Attaching Stud

Owner Notification

A letter will be sent to every registered owner of an affected outboard. The letter will advise the owner to return their outboard to their selling dealer or any Mercury/Mariner authorized dealer for the replacement of the shift link. A copy of the letter and warranty claim is included with this Service Information Bulletin.

Dealer Outboard Inventory

Affected outboards in dealer inventory **MUST** have the shift link replaced when being installed/rigged on boats, (See parts required).

Service Parts Stock

USA customers: Return any 814193 5 shift links in your inventory using the Mercury Precision Parts UNDER 30 DAYS RETURN PROGRAM. You may use the form on the back of any parts and accessories packing list. Please note on the form that the return is part of Service Information Bulletin 2000-16. All returns must be sent freight prepaid to:

Mercury Marine Attn: Return Goods – Service Information 2000-16 W6250-22A Pioneer Road Fond du Lac, WI 54935

Non-USA customers: Return 814193 5 shift link to the appropriate distribution center for credit. Follow the normal return parts procedure. Please make reference to Service Information Bulletin 2000-16.

Inspection

Before proceeding with the following correction confirm that the work has not been completed prior to receiving the engine. Refer to the Midas system under engine history.


ENGINE IN CARTON: If engine is still in the carton, check for a GREEN dot near or on the serial number label. If GREEN dot is present, no further action is required, engine has been reworked at the factory.

ENGINE OUT OF CARTON: Check for WHITE paint dot on the top side of the shift link. The WHITE paint dot indicates that the shift link has been replaced and no further action is required.

Correction


If engine is within the above serial number range and does NOT have the marks indicating that it has been reworked, replaced the shift link using the following steps.

• Remove 2 screws securing remote control harness clamp retainer and remove retainer.

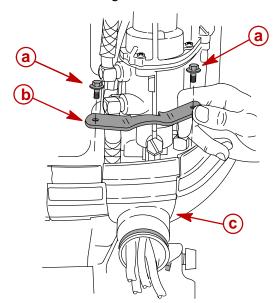


57803

- a Screws (2)
- **b** Retainer
- c Clamp
- Remove the 4 screws securing bottom cowl halves and remove PORT side bottom cowl.

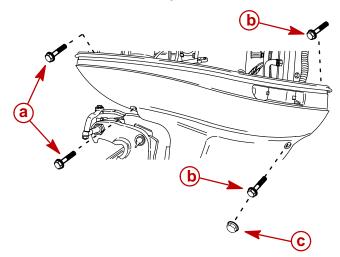

- a Front Retainer Screws (2)
- **b** Rear Retainer Screws (2)
- c Plug Lower Rear Retainer Screw

Remove the nut, washer, shift cable, and shift slide from the rear shift link attaching stud.

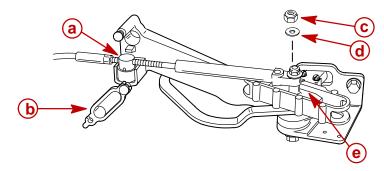


- a Cable Barrel
- **b** Shift Cable Retainer
- c Locknut
- d Washer
- e Shift Slide
- With engine not running, shift the engine into reverse by hand.

NOTE: When shifting into reverse, rotate propeller shaft.

 Remove the nut that attaches the shift link to the upper shift shaft, retain the nut and spacer to be reused on the replacement shift link.

NOTE: The view below is shown with the front retainer nut loose and spacer NOT engaged into the upper shift shaft.

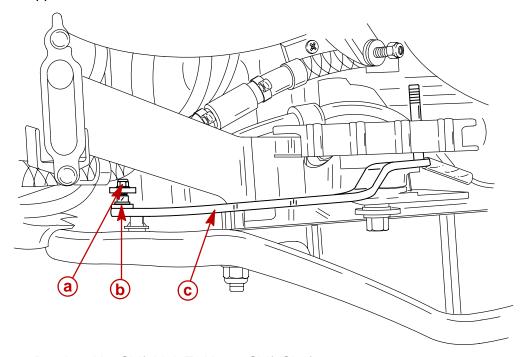

- a Retainer Nut Shift Link To Upper Shift Shaft
- **b** Spacer
- c Shift Link Assemble
- Install shift link into upper shift shaft, taking care that plastic bushing enters the shift shaft correctly. Install the nylock nut and drive tight.
- Reinstall shift slide, shift cable, washer, and nylock nut.
- Reinstall the port side bottom cowl, and harness clamp retainer.

Parts Required

Qty. 1 P/N 81419	S Shift Link
------------------	--------------

Repair Identification

After the shift link has been replaced, put a WHITE paint dot on top of the shift link bracket.

Warranty

Replacement of the shift link for product within the serial number range and product range identified above will have the replacement shift link installed under the product warranty.

Complete warranty claim listing

- Outboard serial number
- One (1) shift link P/N 814193 6
- 0.6 hour labor
- Flat rate code NJC
- Failure code 223-40

Page 6 of 8 NOVEMBER 2000 2000-16



Mercury Marine *Marine Products and Services*

W6250 Pioneer Road P.O. Box 1939 Fond du Lac, WI 54936-1939 USA Phone: 920-929-5000 www.mercurymarine.com

Dear Mercury Marine Customer:

Our records indicate that you are the owner of a Mercury/Mariner outboard included in a recall being performed in compliance with the Federal Boat Safety Act. Due to a manufacturing error, some shift links may have insufficient weld penetration between the bracket and shift cable attaching stud. This could result in possible attaching stud breakage and loss of shift control. Mercury Marine has approved the replacement of the shift link.

WHAT YOU SHOULD DO

Contact your authorized dealer, preferably the one who sold you the engine, and make arrangements to determine if your engine needs to be repaired. The dealer will refer to Mercury Outboard Service Information Bulletin 2000-16 for instructions. You must deliver your engine to the dealer and present this letter, the reverse side of which is a claim-form your dealer needs to send to us for reimbursement.

NOTE: If your boat is in storage, you may want to wait until you remove it from storage to have this service performed.

WHAT WE WILL DO

We will reimburse the authorized dealer for the replacement of the shift link in line with the service bulletin.

We apologize for any inconvenience this recall may have caused you; however, we have taken this action to ensure that your boating experiences will be safe and enjoyable.

Sincerely,

Mercury Marine

	MERC	YIRV	WARRANT	ry Clai	IM		_			
			A STATE OF THE STA	DATE RECEIV	/-/5 \	PROMISE	5	ENGINE S	SERIAL NUMBE	•
			AW							
CUSTOM	ER NAME		DEALER CODE					PRODUCT (CHECK ONE ONLY)	DATE FAILED
ADDRESS			DEALER NAME					X OUTBOARD		DATE REPORTED
ADDICESS								STERNDRIVE		DATE REPAIRED
CITY, STATE, ZIP			DEALER ADDRESS					INBOARD		
MODEL / SERIAL NUMBER			CITY, STATE, ZIP					INFLATABLES		HOURS USED
MODEL / SERIAL NOMBER			יין זיין דיין דיין דיין דיין דיין דיין ד					∐ JET		
DATE OF SALE			ORDER NUMBER LABOR RATE				QUICKSILVER P&A (ATTACH RECEIPT)			
FACRISTIC	N OF FAILURE							OTHER - SPECIF	·Y	
ESCRIPTIO	Shift L	ink 3.0 Litre -	Service Bulle	tin 2000	1-16			BOAT TYPE		
								HAN.		
223-4	O Shift Tinkage	NOTE: WARR CEIVED WITH	ANTY CLAIM MUST BE R	RE- PRE-AUTHOR	ZATION NUMBER ENTER	DATE				
223-4	o philic minkage -							OR PERFORMED PER	FLAT RAT	F MANUAL
QTY	PART NUMBER	REPAIR PARTS I		N LEE LEST PE	ies III i i i i i i i i i i i i i i i i i		CODE	DESCRIPTION	HOURS	DOLLARS
1	814193 6	Shift Link					NJC		0.6	
	014193 0	SHILC DILK					NOC	:	0.0	
								(a) (a)		
· · · · · · · · · · · · · · · · · · ·								TOTAL PARTS		
								20	3 JOJAL	
									TAX	
								SUBLET (RECEIPT A	TTACHED)	
								FREIC (ATTACH IF OVER	HT RECEIPT \$10.00)	
									O TOTAL	
								ATTEN	TION	
LUCBERY	AUTHORIZE THE ABOVE REPAIR	MODE TO BE DONE AND								
GRANT Y	OU AND/OR YOUR EMPLOYEES	PERMISSION TO OPERATE								
THE UNIT	AS NECESSARY FOR TESTIN	NG AND/OR INSPECTION.	CUSTO	MER AUTHORI	LATION					