

# Service Bulletin

Bulletin No. 2015-17

Circulate to:	Sales Manager	☐ Accounting	Service Manager	Technician	Parts Manager

## 3.0L EFI Piston Specification in Service Manual 90-884294R01 Correction

### Scope


Worldwide

#### Situation

Service Manual 90-884294R01 has incorrect piston dimensions listed on pages 1A-2, 4A-2, and 4A-50.

#### Correction

On the previously identified pages in Service Manual 90-884294R01, cross-out the incorrect piston dimensions and write the correct dimension in the specification table. Refer to the following illustration.

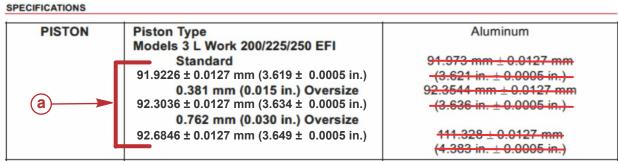

59008

#### a - Correct piston dimensions

Correct Piston Dimensions			
Standard	91.9226 ± 0.0127 mm (3.619 ± 0.0005 in.)		
0.381 mm (0.015 in.) Oversize	92.3036 ± 0.0127 mm (3.634 ± 0.0005 in.)		
0.762 mm (0.030 in.) Oversize	92.6846 ± 0.0127 mm (3.649 ± 0.0005 in.)		

The information will be corrected when the manual is revised.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.