



Number: 77-9

Date : 6/30/77

CIRCULATE TO:

SERVICE MGR

PARTS MGR

MECHANICS


Place in Your
"Service Bulletins"
Binder

- A. Transom Assembly Serial Numbers
- B. MCM 140 and 165 Exhaust Elbow Fastening Screws
- C. Hydraulic Connector (B-47347) Lockwasher
- D. Motorola Alternators for 1978 Model V-8 Engines


A. TRANSOM ASSEMBLY SERIAL NUMBERS

(Attach Bulletin Reference Sticker to P. 1A-4 of Your Service Manual.)

A serial number decal will be added to all MerCruiser transom assemblies, starting with the 1978 model year. Decal will be located as shown in Figures 1 and 2. Dealers will be required to add this serial number to the warranty card, as is currently done with the engine and drive unit.

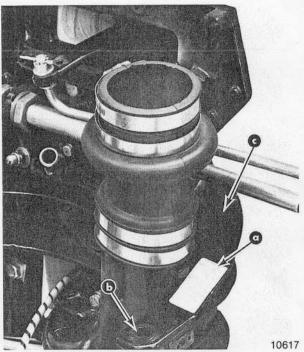

- a Serial Decal
- b Engine Mounting Location
- c Inner Transom Plate

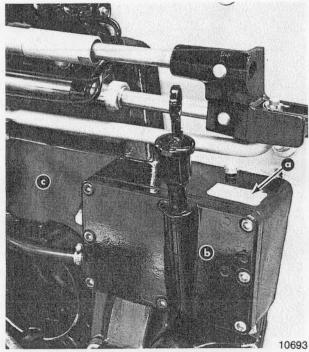

- a Serial Decal
- b Stern Drive Oil Reservoir
- c Inner Transom Plate

Figure 1. MerCruiser 120-140-165-470-898-228 Figure 2. MerCruis and 250 Serial Decal Location Serial Decal Location

Figure 2. MerCruiser 228TR-330TR and 330TRS Serial Decal Location

B. MCM 140 and 165 EXHAUST ELBOW FASTENING SCREWS


(Attach Bulletin Reference Sticker to P. 2A-1 of Your Service Manual.)

Fastening screws (C-10-37612), which retain exhaust elbow (gimbal housing to engine), will be superseded by 5/16" (allen) socket head screw C-10-60992. (Figure 3) This change was made to eliminate torquing difficulties and to ensure proper installation.

C. HYDRAULIC CONNECTOR (B-47347) LOCKWASHER

(Attach Bulletin Reference Sticker to PP 2A-4, 2B-4 and 2C-6 of Your Service Manual.)


An internal lockwasher (C-13-78968) will be installed between the hydraulic connector (B-47347, located on the bottom of gimbal housing) and its retaining nuts C-11-35888. (See Figure

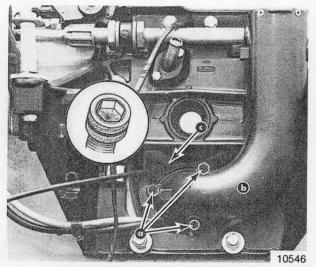

a - 5/16" Allen Screws b - E c - Gimbal Housing

b - Exhaust Elbow

Figure 3. MCM 140 and 165 Transom Assembly with Exhaust Elbow Installed

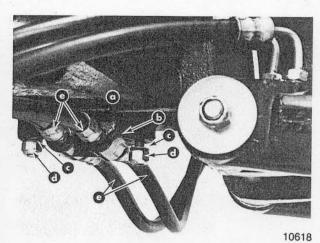

a - Gimbal Housing

c - Internal Lockwashers (2)

b - Hydraulic Connector

d - Nuts (2)

e - Hydraulic Hoses (4)

Figure 4. Hydraulic Connector and Internal Lockwasher Location

4.) When installed, the internal lockwasher will penetrate the painted surface of the hydraulic connector and provide positive electrical continuity between the 2 mounting studs, the hydraulic connector and the 6 hydraulic lines that are connected to the hydraulic connector.

D. MOTOROLA ALTERNATORS for 1978 MODEL V-8 ENGINES

(Attach Bulletin Reference Sticker to Section 3C Index of Your Service Manual.)

MerCruiser 1978 model V-8 engines will be equipped with Motorola alternators. Motorola alternator output is slightly higher than the single-wire Delco that has been used, and it also will permit the use of battery isolators. In-line 120-140-165 engines will continue with the Delco (a 3-wire model that also will allow use of battery isolators).

NOTE: Battery isolators CANNOT be used on single-terminal Delco-Remy alternators presently used.