

CIRCULATE  
TO:

SERVICE MGR.

PARTS MGR.

MECHANICS


Place in Your  
"Service Bulletins"  
Binder

## POWER TRIM - TRIM ACTION

*(Attach Bulletin Reference Sticker to P. 7A-1 of Your Service Manual.)*

There is a possibility that some Power Trim pump assemblies with Harness Connector B-84-79147 (Figure 1) may have a shorted condition that could allow the Power Trim motor to actuate itself in the "up" direction.

If this symptom exists, check the harness connector for a shorted condition between the harness' three wires. If shorted, replace the connector and submit a properly completed warranty claim (including transom assembly Serial Number) and the connector to your Branch or Distributor for credit.

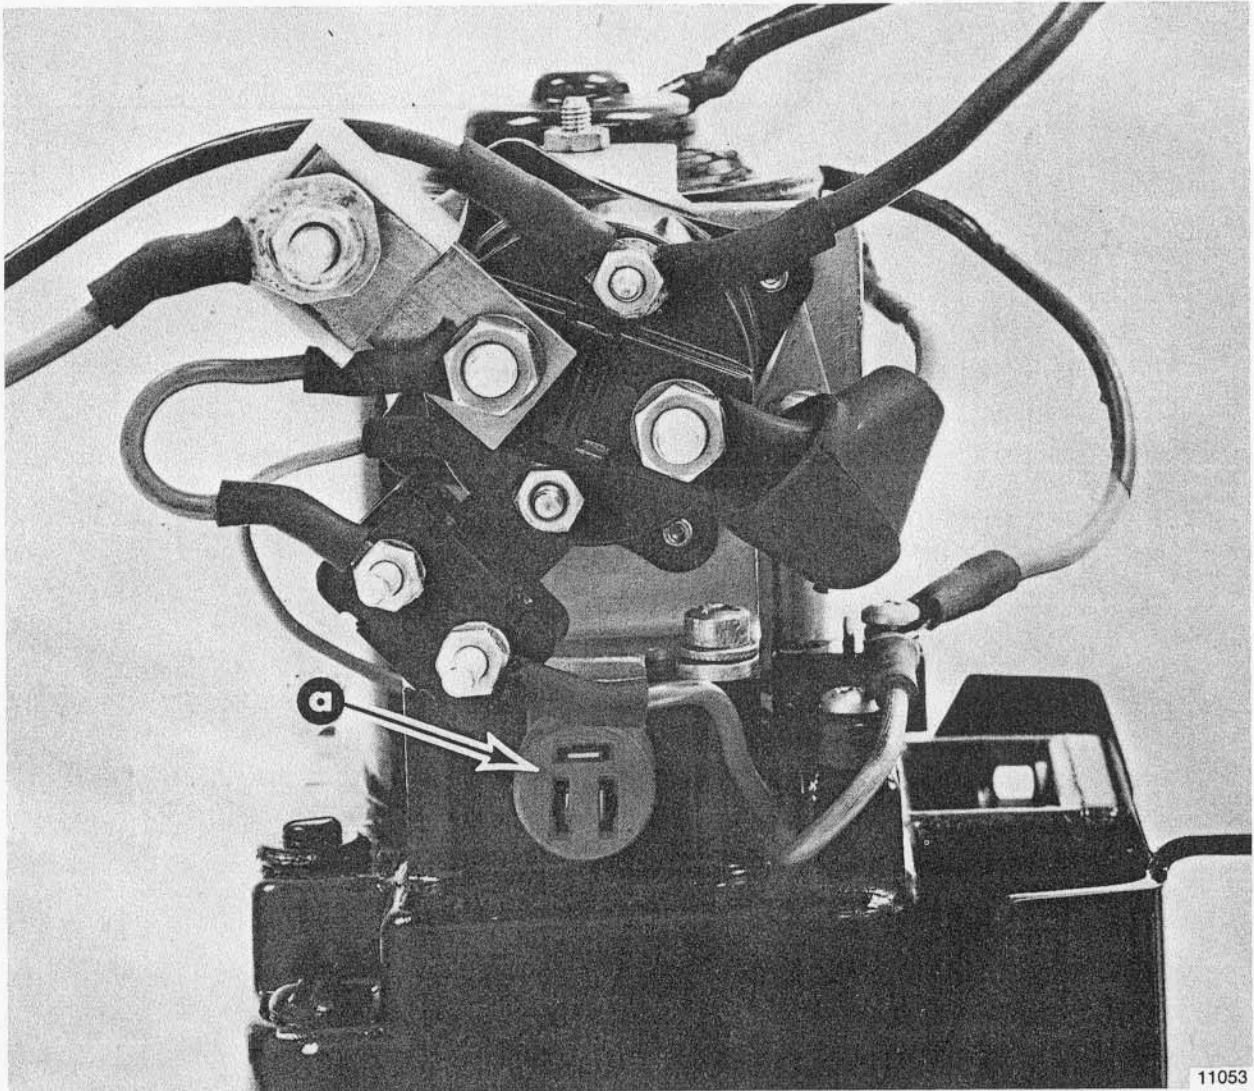

a - Harness Connector

**Figure 1. Harness Connector Identification**