


TO: SERVICE MANAGER MECHANICS
PARTS MANAGER

No. 86-7

- A. TR/TRS Exhaust Tube Missing on Gimbal Housing Assembly.
- B. TR/TRS Power Steering Control Valve Grease Fitting

A. TR/TRS EXHAUST TUBE MISSING on the GIMBAL HOUSING ASSEMBLY

On some TR/TRS gimbal housing assemblies, the exhaust tube (a) was not put on the gimbal housing in production. If the exhaust tube is missing, you would detect a louder exhaust noise at idle with the drive unit fully down. The following serial group is affected A587717 thru A610971.

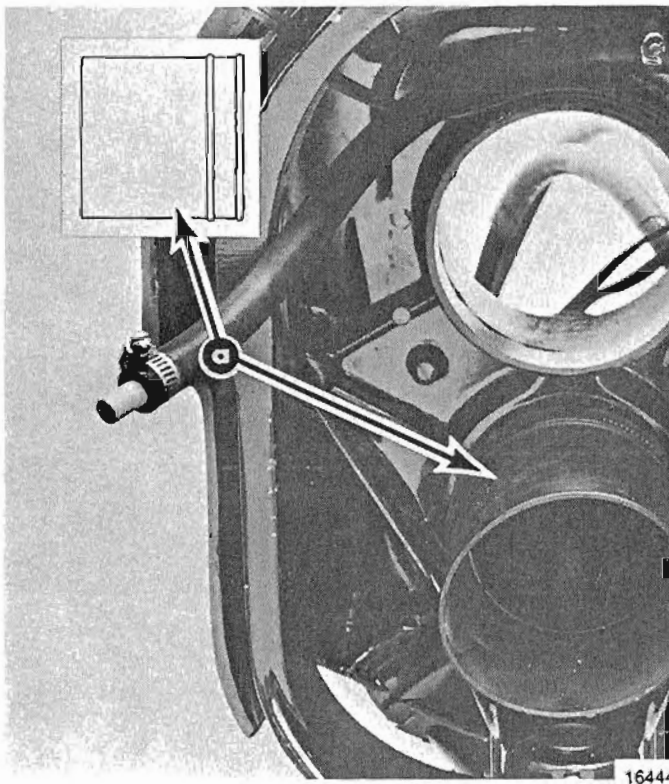

Order part number 78632A1 tube and clamp 54-38889 and install. Submit warranty claim to your regional service center.

B. TR/TRS POWER STEERING CONTROL VALVE GREASE FITTING

The grease fitting (a) on the control valves were turned down for a period of time during production. The fitting must be turned up to allow the valve to be greased. The following serial number group is affected.

A543321 thru A588562

