

TO: SERVICE MANAGER TECHNICIANS
PARTS MANAGER

No. 89-31


Hurth Transmission Fluid Recommendation

The transmission fluid recommendation for the Hurth transmission is Dexron II. This fluid should not be substituted by any other type oil.

Alpha One - Bravo One and Bravo Two Trim Sender Indexing Marks Misaligned

It has been brought to our attention that the indexing marks on the Alpha One and Bravo One and Bravo Two trim position sender may not be aligned properly. Please remove and align indexing marks as shown in the following diagram. When indexing marks are misaligned the trim gauge needle will jump to the top end of the gauge scale when trimming. Units affected are from serial number 0C833540 thru 0C888889.

IMPORTANT: Sender adjustment must be done with stern drive at full down "IN" position. DO NOT adjust sender with stern drive at maximum trim position because sender may be damaged or give incorrect gauge readings.

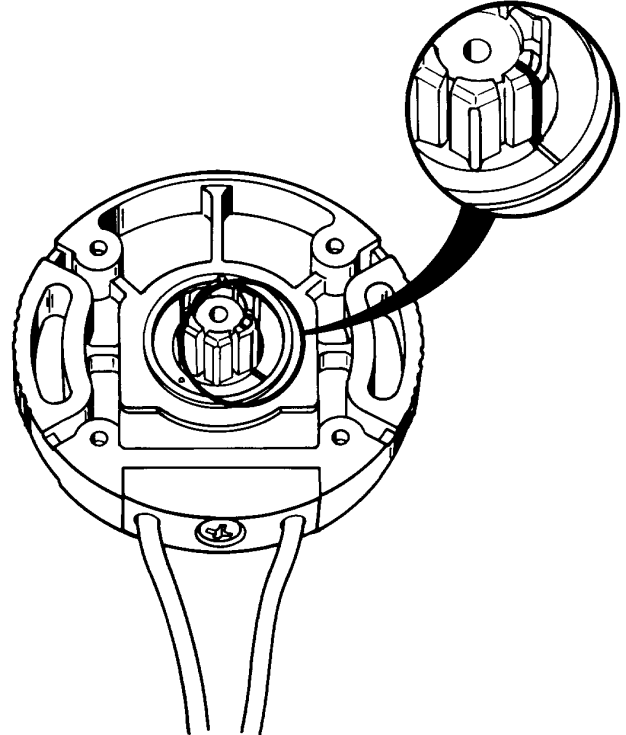

50842