

WARRANTY INFORMATION

SERVICE INFORMATION

Required MIE 8.1S/8.1S HO PCM 555 Replacement

Models

MIE 8.1S Horizon Inboard Engines, S/N 0M027318 – 0M027798.

MIE 8.1S HO Inboard Engines, S/N 0M027318 – 0M027816.

Situation

Under certain conditions, a transmission 'rattle' may be heard at idle rpm in or out of gear.

Inspection/Correction

Look at the white label on the Propulsion Control Module (PCM) near the harness connector. If it has 863620-1 or 863621-1, it has to be replaced.

If the white label has the check sum number 863620-2 or 863621-2, as shown on the examples below, it does not have to be replaced.

496 MAG BASE MIE or 8.1L S

496 MAG HO MIE or 8.1L S HO

863620-2

863621-2

859610

859610

Part Required

P/N 863620T 2 PCM 555 for MIE 8.1S Horizon.

P/N 863621T 2 PCM 555 for MIE 8.1S HO.

Warranty

Submit warranty claim through your normal warranty-processing channel.

Warranty Code and Labor: MJ23 0.8 Hours.

Uniform Failure Observation (UFO) Code: 731 – 40.

Old Part. USA and Canada: Return with warranty claim.

All Other: Retain for disposition by a Marine Power representative.