



Service Bulletin

Bulletin No. 2007-67
CMD 2007-07

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

Ground Strap on all Diesel Transoms

Models Affected


Model	Serial Number
All diesel Alpha and Bravo transoms	0W452481-1A410122

Situation

All transoms in the affected serial number range require an additional ground strap between the inner transom plate and the engine ground or battery ground to complete the continuity circuit.

Correction

The ground strap is already included in the parts bag for all diesel transoms SN 1A410123 and above. For models affected (above), add a ground strap. Certain applications such as driveshaft extension kits may require a longer strap to complete the ground circuit.

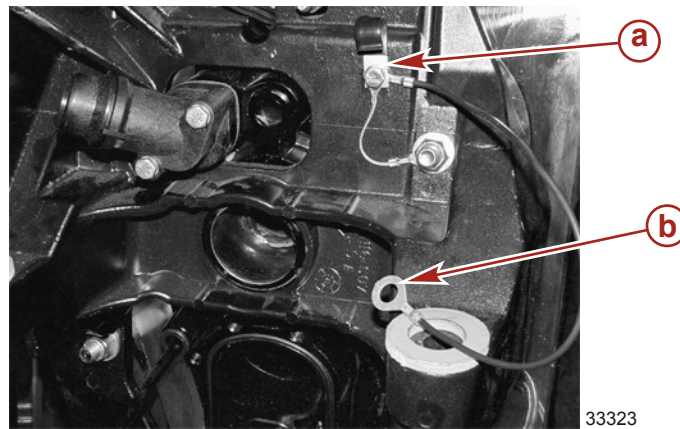

- a** - Inner transom plate ground strap location
- b** - Attach to engine or battery ground

Part Required

Ground strap (P/N 62826A6) with a length of 33 cm (13 in.). If constructing a new strap, use at least 14 gauge wire and appropriately sized ring eye connectors.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Warranty

CMD will credit the dealer for the cost of labor through December 17, 2008. Submit a warranty claim through your normal warranty processing channel, listing:

- MerCruiser transom serial number
- Flat rate code and labor: ME75
- Part code: 228
- Failure code: 88

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.