


Stator (P/N F616095)

85 HP Force Outboard (1986 and prior models)

No spark on No. 3 cylinder after installation of replacement stator (Part Number F616095).

Inspection

Inspect the wire and pin at the back of the plug (1) on the connector from stator. The yellow wire should be connected to the pin at terminal number 2 of plug (1). The terminals are marked. If the wire goes to the pin at terminal number 1, stator must be replaced.

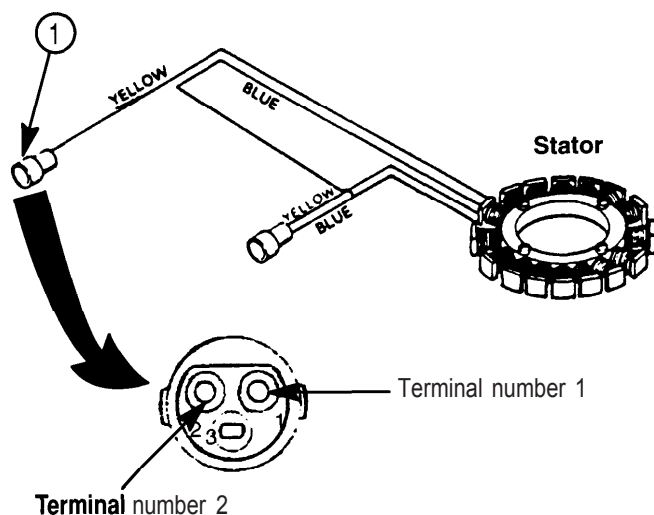

If there are any F616095 stators in your inventory, please inspect them. If any are found to be defective, contact your distribution center for exchanges.

Warranty

Complete and submit a warranty claim.

1. List outboard serial number and model number.
2. List qty. 1 of F616095 stator.
3. List 0.7 hour of labor to replace stator.
4. List "NJC" for labor code.
5. List 323-03 for failure code.

Return defective stator with warranty claim.

INTERNATIONAL - Follow instructions issued by your Marine Power international office or by your distributor.