

## Mid Range Surging and/or Poor Acceleration 70 HP

We have received reports on the 70 HP outboards where the engine surges between 3000 RPM and 4000 RPM. The problem was found to be in the machining of the carburetors. Check the part number on the carburetor mounting flange (a). If the part number is 749061 and the engine has this condition, the carburetor should be replaced. The part number for the replacement carburetor is 1300-826369.

*NOTE: Perform a thorough troubleshooting procedure before replacing carburetor. Other problems can produce the same symptoms.*

### WARRANTY:

If the engine is within the warranty period and this condition exists replace the carburetor and complete a warranty claim.

1. List outboard serial number(s).
2. List quantity 1 of 1300-826369 carburetor.
3. List five tenths (0.5) hour labor to replace carburetor per engine.
4. List 703-00 for failure code.
5. List 0F11 & 0F16 for labor code.

If the engine is out of the warranty period and this condition exists, contact the service department for pre-authorization to replace the carburetor.

INTERNATIONAL-Follow instructions issued by your Marine Power international office or by your distributor.

