


Ignition Module Overheat Condition

Models Affected;

Following 1999 model year engines within the listed serial number range, equipped with Thunderbolt-V ignition module (as shown).
500 Carb (OL414644 to OL415001), 500 Bulldog (OL414620 to OL414986)
525SC (OL414720 to OL414967), 800SC (OL414638 to OL414745)

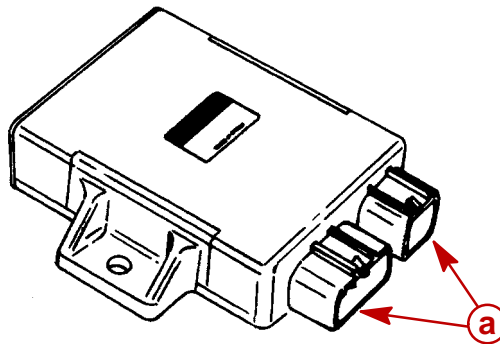

a - Thunderbolt V Module - Two Separate Connectors

Problem

Excessive internal ignition module heat may result in module failure.

Solution

Installation of an IGNITION MODULE HEAT SINK PLATE KIT 841868A1 which fits against the ignition module to help draw excessive heat away from the module.

Warranty

If installation of a heat sink plate kit is required, complete a warranty claim listing

Engine serial number

- Qty. 1 P/N 841868A1 Ignition Module Heat Sink Plate Kit
- One (1) hour labor
- Warranty Flat Rate Code: NJC
- Failure Code: 302-87

Complete/process claim via Midas or return a warranty claim form.

INTERNATIONAL: Follow instruction issued by Marine Power International office or by your distributor.