

Circulate to:     Sales Manager     Accounting     Service Manager     Technician     Parts Manager

## 40/50/60 EFI FourStroke 4 Cylinder Ignition Coil Testing Specifications

### Models Affected

Models Covered	Serial Number or Year
40/50/60 EFI FourStroke 4 cylinder engines	1C050252 and above

### Scope

Worldwide


### Situation

Mercury Marine has found an error in the service manual 90-8M0105570 for the 40/50/60 FourStroke 4 cylinder engines. The ignition coil testing specifications section has the incorrect resistance values published.


### Correction

Refer to the table on information for revised ignition coil testing specifications.

Place a copy of this service bulletin in the appropriate service manual for future reference. Mercury Marine will correct this error in the next printing of this service manual.

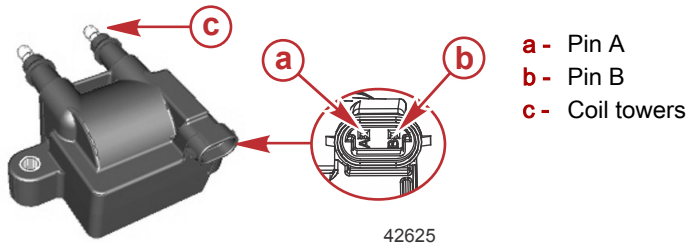

Ignition Coil Resistance Test	
Between coil towers	7200–8800 Ω
Between pin A and B	0.3–0.5 Ω

DMT 2004 Digital Multimeter	91-892647A01
 <p>4516</p>	<p>Measures RPM on spark ignition (SI) engines, ohms, amperes, AC and DC voltages; records maximums and minimums simultaneously, and accurately reads in high RFI environments.</p>

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.