

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

Armature No Longer Available


Models Affected

NOTE: Revised September 2008. This bulletin supersedes the previous service bulletin number 2007-06 (November 2007).

Models Covered
All Dura-Amp 36 V trolling motors

Description

Armature Model MXF320712 is no longer available.

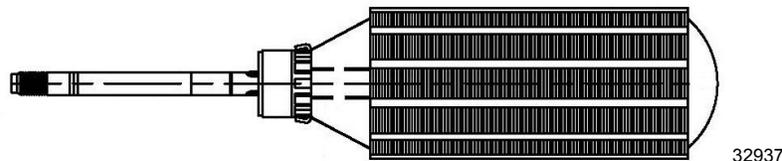

Correction Instructions

For Dura-Amp 36 volt trolling motors with damaged or shorted armatures, please note the following for repairs:

- If the trolling motor has already been converted to the digital system, replace the defective armature with part number M889297T.
- If the armature fails and the unit has not been converted to the digital system, replace the armature with part number M889297T. Upgrade the unit to digital using the appropriate conversion kit listed in the chart below.

NOTE: Part number MZF320712 supersedes to, and may be used in place of, M889297T.

Parts Required

Motor	Conversion Kit Part Number
Freshwater, foot-operated motor	MXC60241
Freshwater, hand-operated motor	MXC60251
Saltwater, foot-operated motor	MXC60281
Saltwater, hand-operated motor	MXC60291

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.