



# Service Bulletin

Bulletin No. 2005-66  
CMD 2005-06

Circulate to:  Sales Manager  Accounting  Service Manager  Technician  Parts Manager

## 2.8L Sea Water Drain Plug Location

### Models Covered

Model	Serial Number
2.8 EI	88010500 and above that use publication 90-865861041

### Situation

The Owners manual PN# 90-865861041 for the inboard version of the above engines has incorrect data on page 81. The call out location for the plug to drain the sea water from the heat exchanger incorrectly points to the freshwater coolant drain plug. Removing this plug will result in the loss of engine coolant.

### Solution

The correct location for draining the sea water from the heat exchanger and transmission cooler is located on the rear of the transmission cooler (refer to figure 1). Owners manual PN# 90-865861041 has been updated with the correct information and is re-issued under part number 90-865861050.

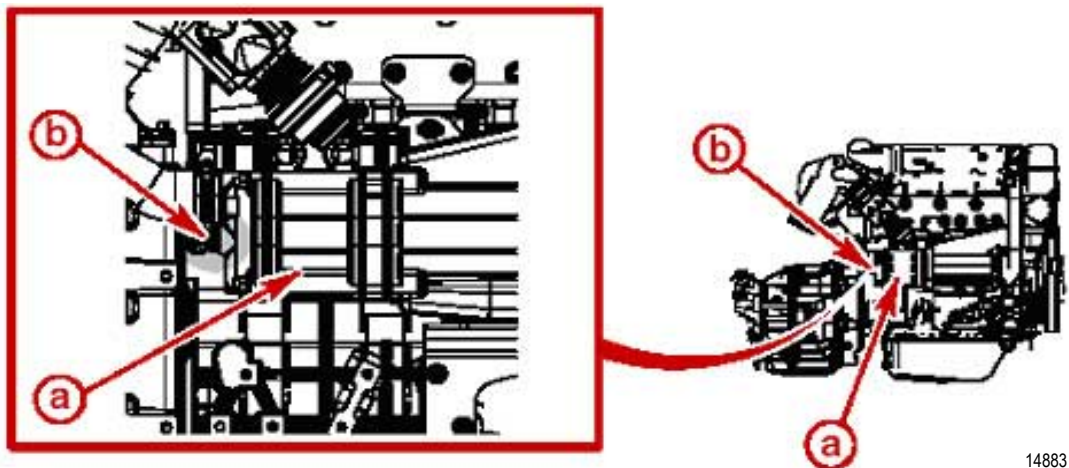


Figure 1

a - Transmission fluid cooler

b - Drain plug, or fitting if equipped

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.