

TO: SERVICE MANAGER MECHANICS
PARTS MANAGER

No. 94-2


A. IGNITION SYSTEM ADVANCE CURVE SPECIFICATION-THUNDERBOLT IV WITH REV-LIMITER

Important: Use of an incorrect ignition module can cause poor engine performance and/or severe engine damage.

MODELS


HP 450 (454 CID-7.4L), HP 500 (502 CID-8.2L)

MODEL: HP 450
Module Part Number: 17316A 1
Type: Thunderbolt IV w/rev limit
Module Advance: 20 degrees
Initial timing: 18 degrees
Total Spark Curve: 38 degrees

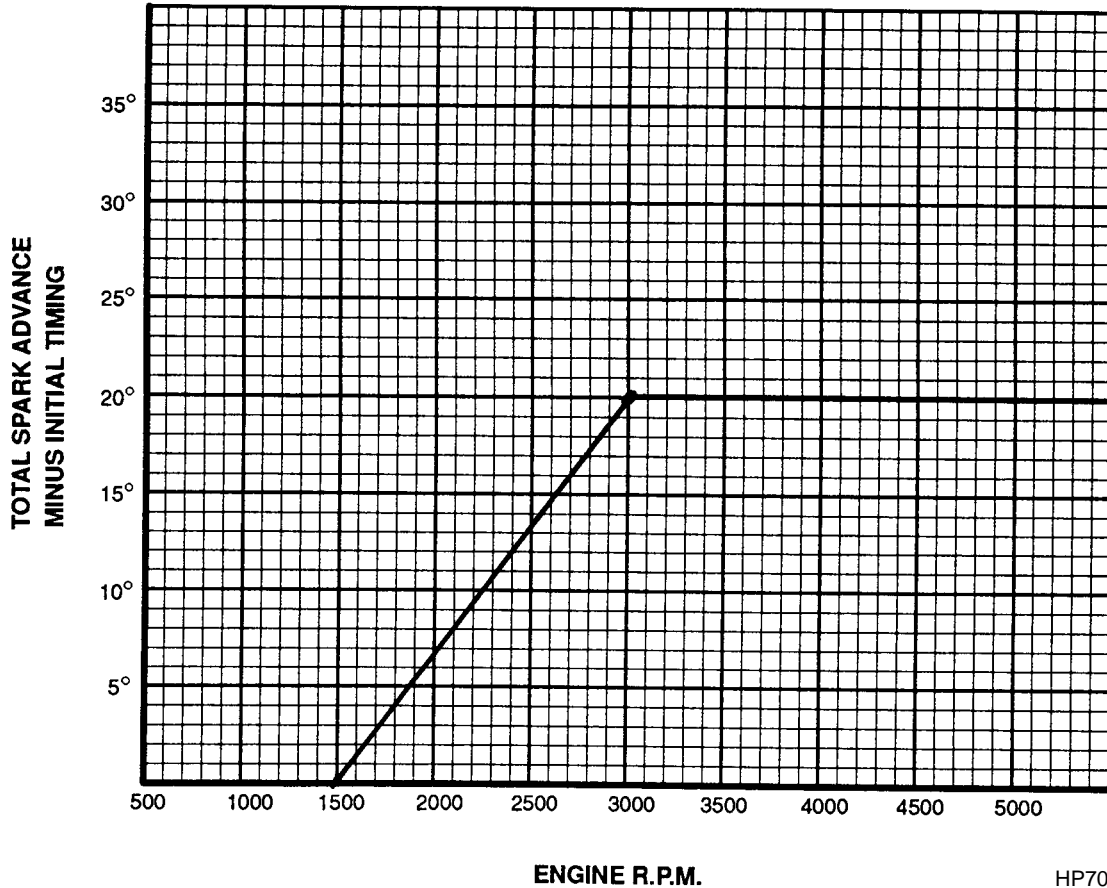

HP70808-2

MODEL: HP 500 (502 CID)
Module Part Number: 17316A-1
Type: Thunderbolt IV w/rev. limit
Module Advance: 20 degrees
Initial Timing: 14 degrees
Total Spark Curve: 34 degrees

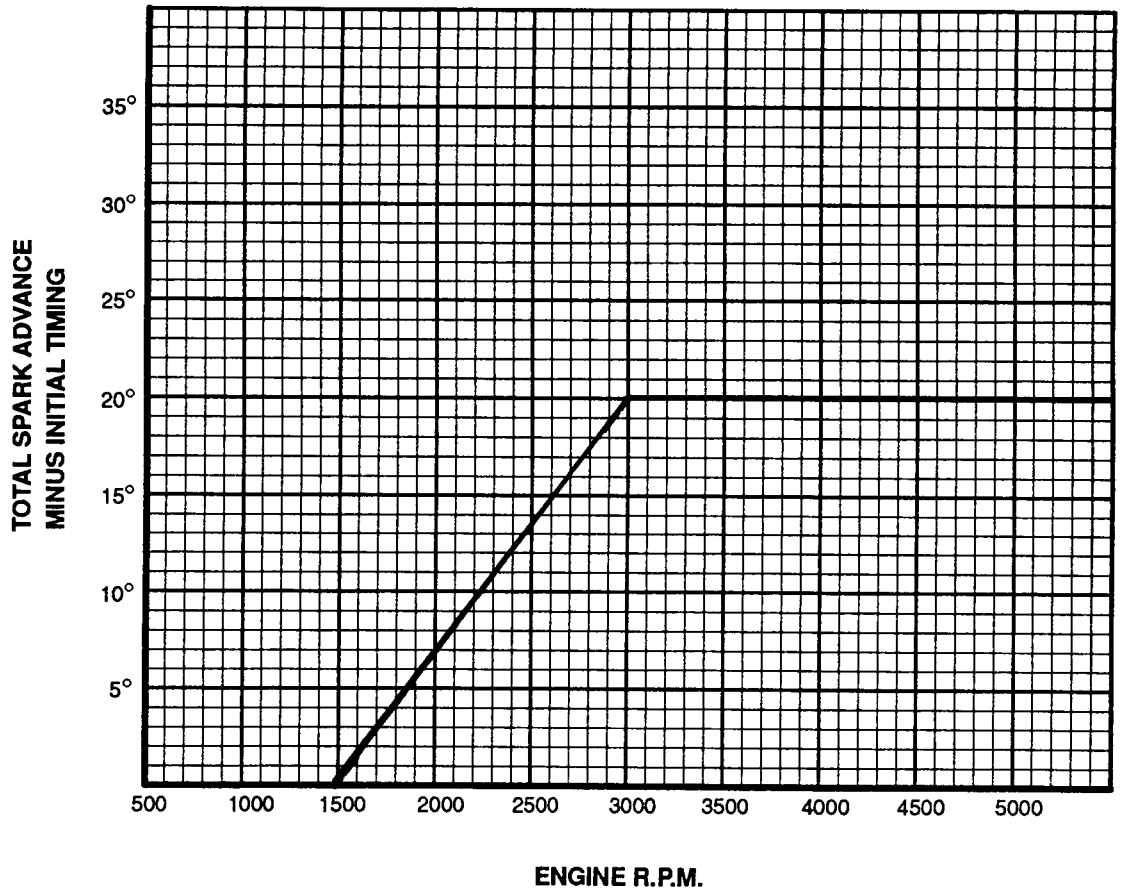

HP70808-2