



Number: 77-4

Date : 11/29/76

MECHANIC ... your assurance of outstanding service

CIRCULATE TO: SERVICE MGR

PARTS MGR

MECHANICS


Place in Your
"Service Bulletins"
Binder

WARNER GEAR TRANSMISSION DIPSTICK OIL LEVEL MARKING CHANGE

(Attach Bulletin Reference Sticker to P. 6D-1 of Your Service Manual.)

The low oil level mark has been removed from all Velvet Drive Marine Transmission dipsticks. A single mark on the dipstick indicates level at which the oil should be maintained. See illustration, below.

Three dipstick assemblies are involved in this change: Dipstick 10-04-559-001 is used in all 71C and 72C reduction units. Use dipstick 10-13-559-001 in all 71C and 72C direct drive units. Dipstick 10-06-559-001 is used on all "V" drive units.

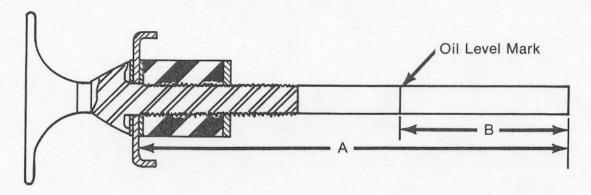

The approximate distance from end of dipstick to the underside of the cap (dimension "A") and from end of dipstick to the oil level mark (dimension "B") are charted below. These dimensions will help identify each dipstick.

Model	Dipstick Part No.	Dimension "A"	Dimension "B"
C71 and C72 Reduction	10-04-559-001	4-1/2" (11.43cm)	1-3/4" (44.5mm)
All "V" Drives	10-06-559-001	6" (15.24cm)	3/4" (19.1mm)
C71 and C72 Direct Drives	10-13-559-001	4-5/8" (11.75cm)	13/16" (20.6mm)